



Possible cause/solution:

1. Cut/Plot switch on right end plate is set to plot. Set the plotter to cut mode by toggling Cut/Plot switch to Cut mode.
2. The knife assembly is installed too far back into the carriage jaw. Loosen thumbscrews and slide the knife assembly forward in the carriage jaw until there is clearance between the knife assembly and the dust cover.
3. The traverse rod may be bent. Try rotating the traverse so that the bow is orientated toward the back of the machine.

If none of the above suggestions solve your problem, remove the dust cover.